MEI vending value coupon and Free vend coupon for the series 2000 bill acceptors.

Verify that the bill acceptor has the software for the coupons.

- For VN25XX and AE24XX - if the week and year (see serial number configuration below), is 402 or newer. – The software is factory installed.
- For AE26XX – if the week and year (see serial number configuration below), is 443 or newer. – The software is factory installed.
- For AE28XX – The software is factory installed.

If the bill acceptor does not have the software factory installed.

- For VN25XX and AE24XX - if the week and year (see serial number configuration below), is between 409 and 402. - The bill acceptor must be downloaded with a bill-programming module (BPM).
- For AE26XX - if the week and year (see serial number configuration below), is between 409 and 443. - A new control board is needed.

SERIAL NUMBER CONFIGURATION:

WW   Y   L   CC   XXXX

Sequential Production Number

Configuration Code

Manufacturing Location

Year Manufactured

Week Manufactured
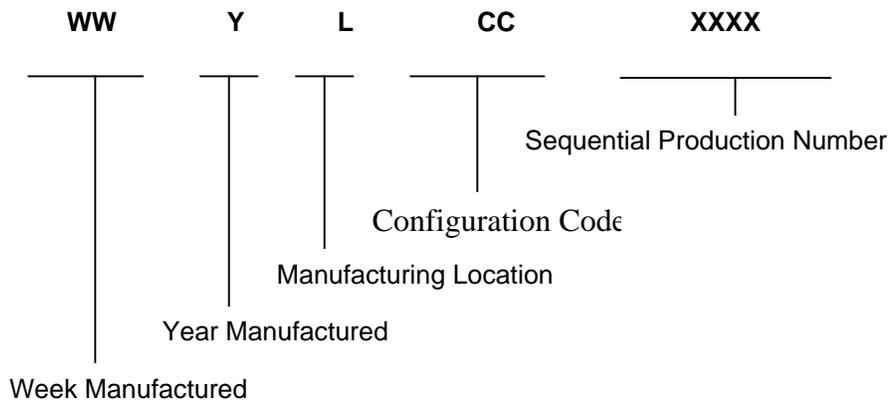
Note:

1. The week range is from 01 to 52. 01 is the first week of the year, and 52 is the last week of the year.
2. For the year:

9 equals 1999	0 equals 2000	1 equals 2001	2 equals 2002	3 equals 2003

TO ENABLE:

1. **Set all option switches to the off position.**
2. **Locate the service button (Blue button)** on the back of the unit (refer to Figure 1). Depress the button once to enter coupon set-up mode. The red light will flash rapidly.
3. **Insert coupon and verify that it goes all the way into the bill acceptor, pauses and then rejects.**
4. **Check** that LED flashes 10 times.
5. **Return all option switches to the original positions.**
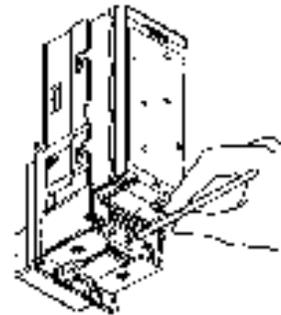
Figure 1

TO DISABLE:

1. **Set all option switches to the off position.**
6. **Locate the service button (Blue button)** on the back of the unit (refer to Figure 1). Depress the button once to enter coupon set-up mode. The red light will flash rapidly.
2. **Insert coupon and verify that it goes all the way into the bill acceptor, pauses and then rejects.**
3. **Check** that LED flashes 3 times.
4. **Return all option switches to the original positions.**

Special Conditions

- The MEI free vend coupon can only be enabled with machines that use the multi drop bus interface (MDB).
- The MEI value coupon can be enabled with all interfaces.